
Smoke and Dye Testing Summary

High Level Sewershed

Run Summary —									
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length		
S1028-257	Smoke	9/1/2009	ADS/TM	S1900_024MH	Dry	Yes	1,210.33		

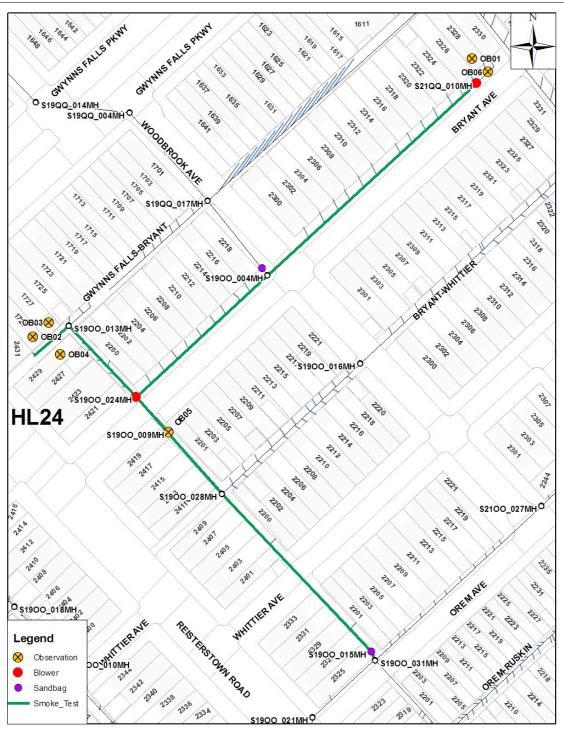

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary ————————————————————————————————————								
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length	
S1028-257	Smoke	9/1/2009	ADS/TM	S1900_024MH	Dry	Yes	1,210.33	

Isolated Pipes

Pipe ID	Upstream MH	Downstream MH	Length (ft)	Diameter (In)
S19OO_024G1	S19OO_024MH	S19OO_009MH	60.9817	8
S19OO_004G1	S19OO_004MH	S19OO_024MH	220.993	8
S19OO_013G2	S1900_013MH	S19OO_024MH	120.947	8
S19OO_038G1	S1900_038DE	S1900_013MH	57.1147	8
S19OO_028G1	S19OO_028MH	S19OO_015MH	268.489	8
S21QQ_010G1	S21QQ_010MH	S19OO_004MH	351.104	8
S21QQ_013G1	S21QQ_013DE	S21QQ_010MH	29.7879	8
S19OO_009G1	S19OO_009MH	S1900_028MH	100.909	8

Observations & Photos

Obs_ID S1028-257-OB01 **Address** 2328 Bryant Ave

Status Private

Source Service Lateral

Location Yard - front **Nearest MH** S21QQ_010MH

Comments Smoke from service lateral in front yard. 2328

Bryant Ave.

Picture \S1028-257-OB01-P01.jpg

Comments Front of house, 2328 Bryant Ave.

Obs_ID S1028-257-OB02

Address 1729 Gwynns Falls Parkway

Status Private

Source Service Lateral

Location Paved concrete **Nearest MH** S1900_013MH

Comments Smoke from service lateral under paved

concrete behind house. 1729 Gwynns Falls

Pkwy.



Picture \S1028-257-OB02-P01.jpg

Comments Back of house, 1729 Gwynns

Falls Pkwy.

Smoke and Dye Testing Summary

High Level Sewershed

Run Summary —									
Test ID	Test Type	Date Inspected	Company / Super.	Blower MH	Ground Condition	Notification Made?	Total Length		
S1028-257	Smoke	9/1/2009	ADS/TM	S1900_024MH	Dry	Yes	1,210.33		

Obs ID S1028-257-OB03

Address 1727 Gwynns Falls Parkway

Status Private

Source Service Lateral

Location Paved concrete **Nearest MH** S1900_013MH

Comments Smoke from service lateral under paved

concrete behind house. 1727 Gwynns Falls

Pkwy.



Picture \S1028-257-OB03-P01.jpg

Comments Back of house, 1727 Gwynns

Falls Pkwy.

Obs_ID S1028-257-OB05 Address 2417 Reisterstown Rd

Status Public

Source Sanitary Manhole

Location Alley

Nearest MH S1900_009MH

Comments Smoke from sanitary manhole S1900_009MH

in alley behind 2417 Reisterstown Rd.



Picture \S1028-257-OB05-P01.jpg

Comments Alley behind 2417 Reisterstown

Rd. looking northwest

Obs_ID S1028-257-OB04 **Address** 2429 Reisterstown Rd

Status Private
Source Cleanout

Location Yard - back **Nearest MH** S1900_013MH

Comments Smoke from cleanout in back yard. 2429

Reisterstown Rd.



Picture \S1028-257-OB04-P01.jpg

Comments Back of house, 2429 Reisterstown Rd.

resters to will rea

Obs_ID S1028-257-OB06 **Address** 2328 Bryant Ave

StatusPublicSourceMain SewerLocationSidewalkNearest MHS21QQ_010MH

Comments Smoke from sanitary sewer under sidewalk in

front of 2328 Bryant Ave.



Picture \S1028-257-OB06-P01.jpg

Comments Front yard, 2328 Bryant Ave.



Monday, October 19, 2009

Page 3 of 3